 






Mount a Qwik-Lok to a Foundation

Easily mount your Qwik-Lok to a Foundation using the provided Mounting Screws.



M8-1.25x25

M12-1.75x35

You will also need an additional Round and Diamond Pin Set (MPIN12S) for each system.

() ATTENTION: When mounting a 50mm Qwik-Lok, an Adaptor (081-0900) is also required.

To order either of the above accessories, contact Chick.



Access the MOUNTING HOLES of your WORKHOLDING SYSTEM

- A. Disassemble your Workholding System to access the Mounting Holes.
- IMPORTANT NOTE: Workholding Systems must be completely disassembled.



1 OF 4



For more information, please call: 724-772-1644 or 800-332-4425






System 5

2 OF 4

Mount a Qwik-Lok to a Foundation

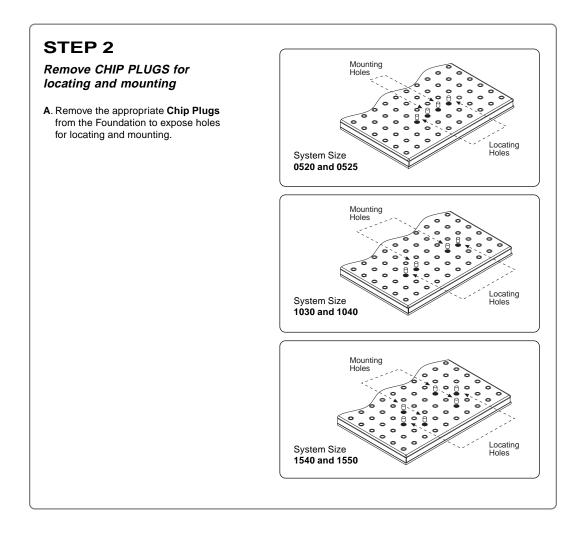



For more information, please call: 724-772-1644 or 800-332-4425





System 5

3 OF 4

Mount a Qwik-Lok to a Foundation

STEP 3

Insert the Round and Diamond Pins into the FOUNDATION

System Size A. Insert the Round and Diamond Pins 0520/0525 into the exposed locating holes (the outermost exposed holes) on the Foundation. Be sure to position the Diamond Pin so that the contact points of the diamond are perpendicular to the centerline that separates the two pins. P Α Round and Diamond Pins R B. Use the supplied Round and Diamond Pin System Size Holding Wrench to hold the Round Pin. 1030/1040 While holding the Round Pin, insert the Hex 1540/1550 Key into its head and turn clockwise. C. Repeat sub-step b) for the other Diamond Pin. SNOTE: Mark alphanumeric locations for repeat setups. С ATTENTION: 50mm Systems require an Adapter Set (081-8900) to mount to a foundation. Install the Adapters in the mounting holes of the Foundation

Α

Round and Diamond Pins

P









Mount a Qwik-Lok to a Foundation

STEP 4

Mount the BASE to the FOUNDATION


- A. Inspect the underside of the **Workholding** System and the top of the Foundations mounting surface to ensure surfaces are free of chips, burs and debris.
- B. Looking through the Base, align the Mounting Holes of the Base with the Foundation's mounting holes. Carefully place the Base onto the Round and Diamond Pins and Mounting Adaptors when applicable.
- IMPORTANT NOTE: Dragging the Base across the Round and Diamond Pins or Mounting Adaptors may damage the Base or lessen the accuracy of the locating surfaces.
- C. Insert the Mounting Screws through the Base and into the exposed Foundation mounting holes. Use the appropriate hex key to evenly tighten the Mounting Screws to the following specifications:

Recommended Torque Settings

Use supplied swivel handle and screws.

System Size	Torque (N•m)	Torque (ft-lb)
0520 - 0525	27	20
1030 - 1040	81	60
1540 - 1550	81	60

Your Workholding System is now mounted and ready to be reassembled!

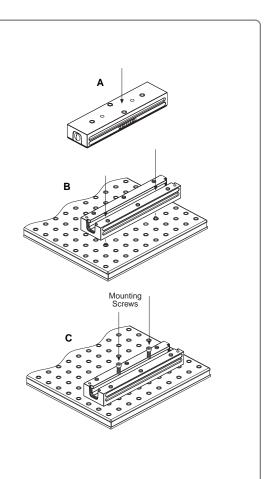

4 of 4

