

## 5VP-KITA-00059

This workholding package is designed for your KITAMURA 1XiF-Sparkchanger machining center.







Notes

**CHICK WORKHOLDING SOLUTIONS, INC**  
500 Keystone Drive • Warrendale, PA 15086 USA  
Phone: (724) 772-1644 • Fax: (724) 772-1633  
Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

# 5VP-KITA-00059

This workholding package is designed for your KITAMURA 1XiF-Sparkchanger machining center.

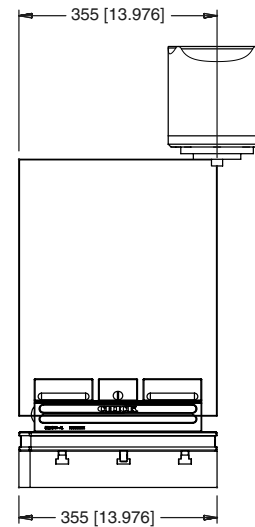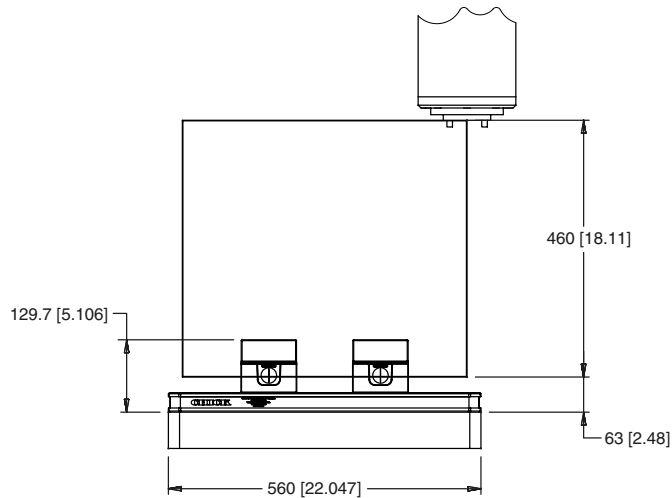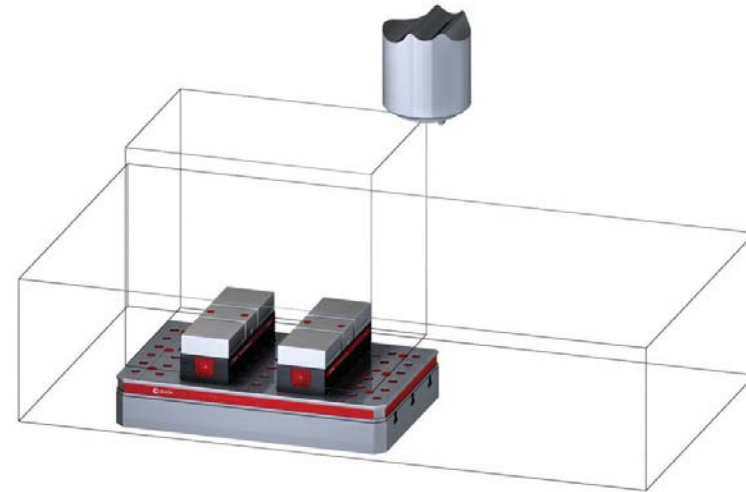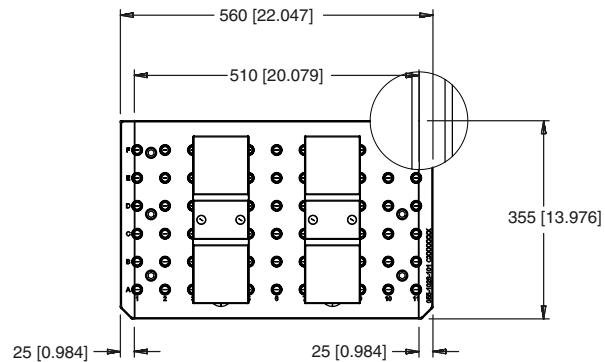

**Notes**




Machine travel may be limited by mechanical interference and/or machine safety zones. Please consult your machine's operating instructions for more information.

All dimensions are MM [IN]

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

# 5VP-KITA-00059

This workholding package is designed for your KITAMURA 1XiF-Sparkchanger machining center.

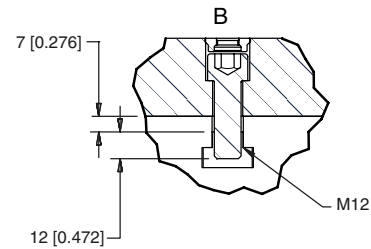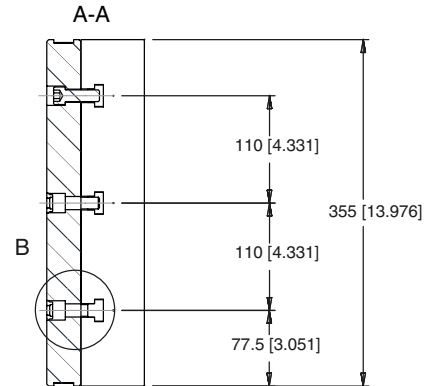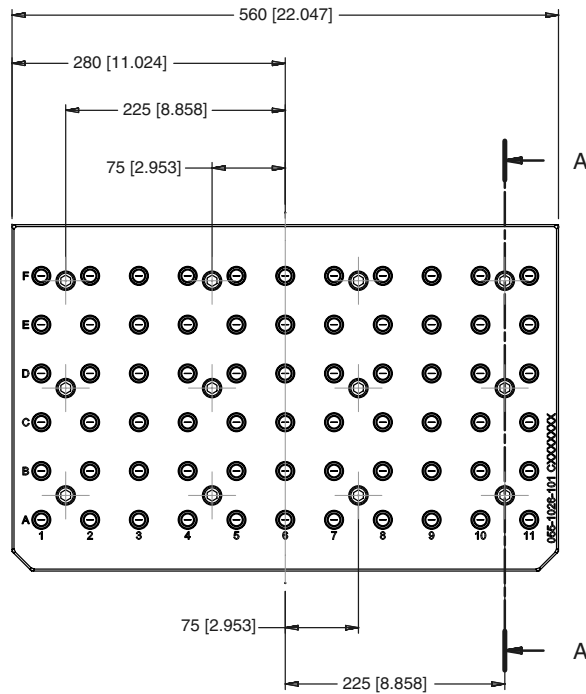


Notes  
All dimensions are MM [IN]

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

# 5VP-KITA-00059


This workholding package is designed for your KITAMURA 1XiF-Sparkchanger machining center.

FOUNDATION LENGTH, DEPTH, AND MOUNTING HOLE CONFIGURATION DESIGNED ACCORDING TO MACHINE TOOL SPECIFICATION

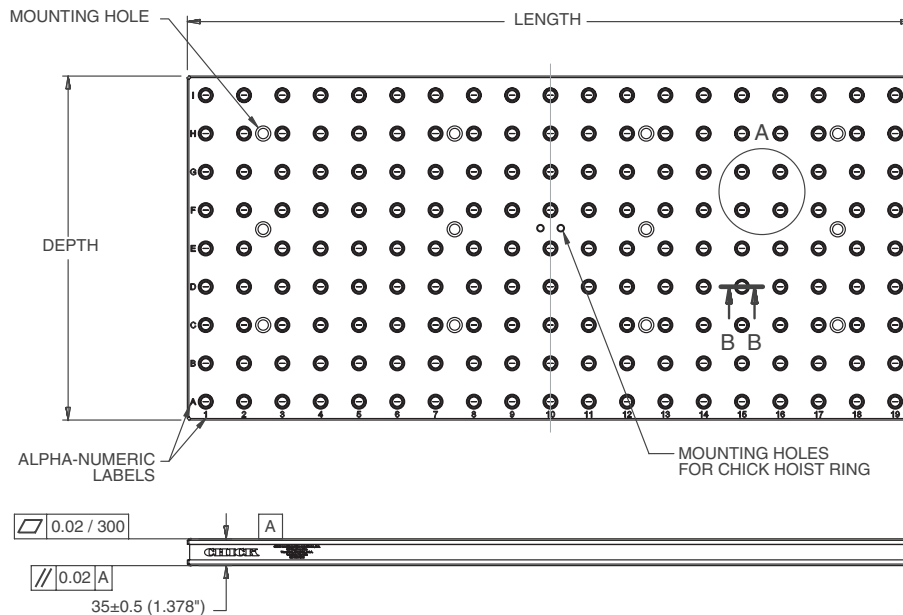


FOUNDATION MAT'L: CAST IRON  
FOUNDATION INCLUDES INSTALLATION HARDWARE

**DETAIL A**

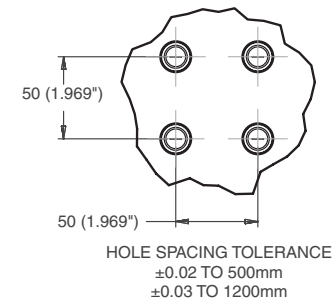

**SECTION B-B**

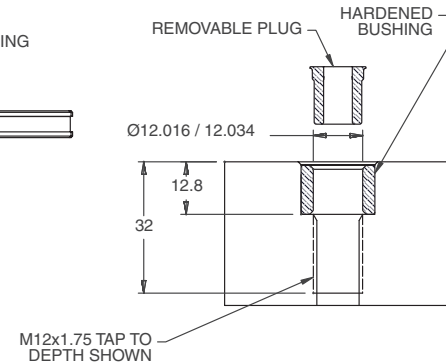


Notes  
All dimensions are MM [IN]

**CHICK WORKHOLDING SOLUTIONS, INC**  
500 Keystone Drive • Warrendale, PA 15086 USA  
Phone: (724) 772-1644 • Fax: (724) 772-1633  
Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

## Batch Production

Machinable accessories are the optimal solution for batch production. They offer QwikChange™ and accurate repeat set ups to optimize the productivity of the machine center.

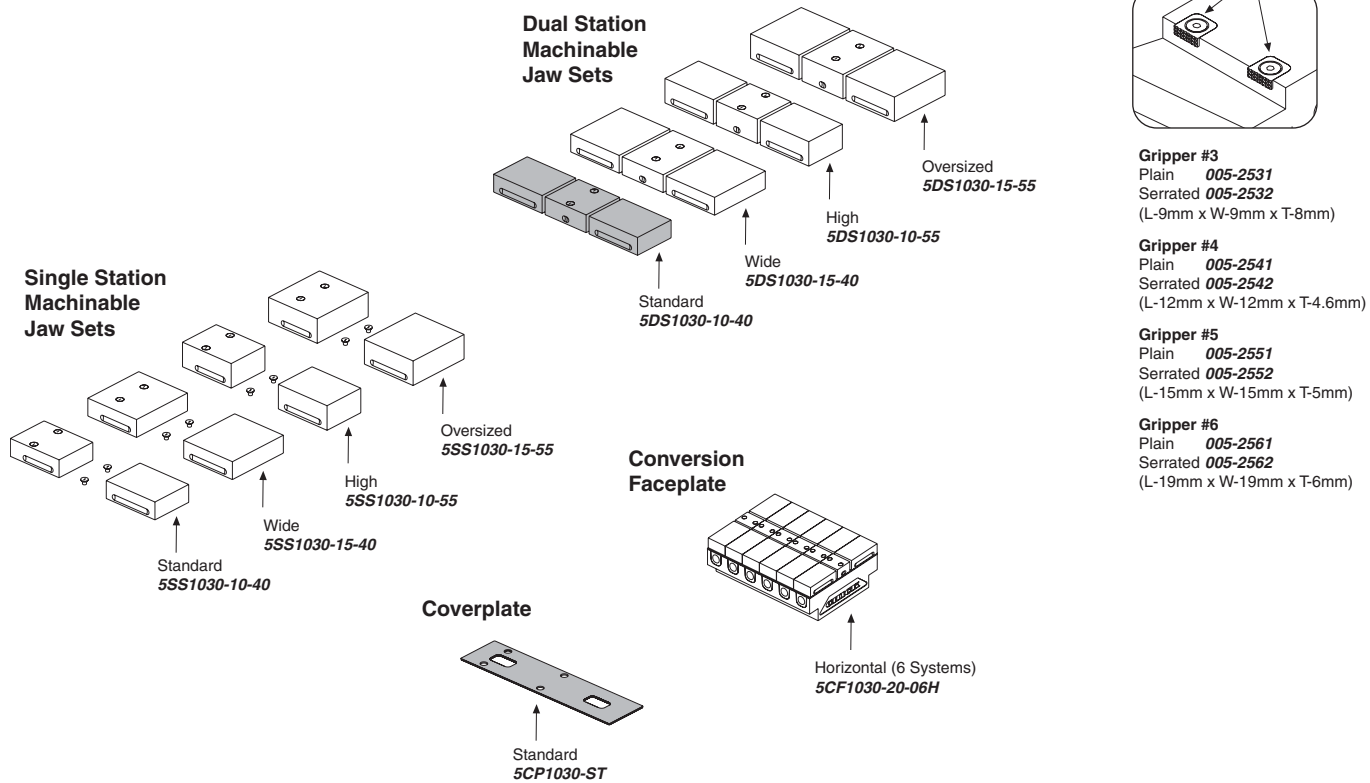


**Notes**

Grey item is included with a standard system

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

## Dedicated Fixturing


Machinable Faceplates provide QwikChange™ dedicated fixturing and are optimal for awkward or hard to hold parts. A mini pallet changer can be created by utilizing two Faceplates in tandem.

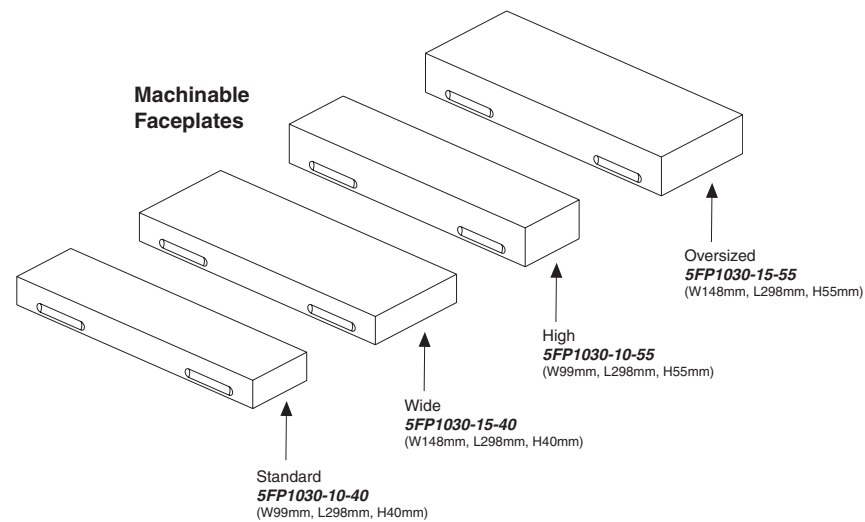

Notes

**CHICK WORKHOLDING SOLUTIONS, INC**  
500 Keystone Drive • Warrendale, PA 15086 USA  
Phone: (724) 772-1644 • Fax: (724) 772-1633  
Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

## QwikChange Machinable Dual Station Jaws

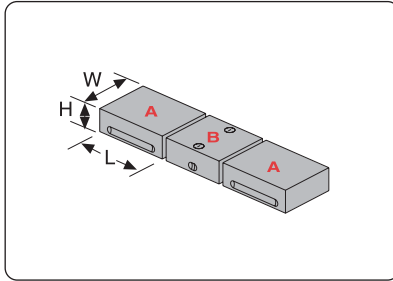

### Individual Dual Station Jaws

#### Standard

- A** Moveable Jaw ..... **5MJ1030-10-40**  
(W99mm, H40mm, L105mm)
- B** Fixed Jaw ..... **5FJ1030-10-40**  
(W99mm, H40mm, L70mm)

#### Wide

- A** Moveable Jaw ..... **5MJ1030-15-40**  
(W148mm, H40mm, L105mm)
- B** Fixed Jaw ..... **5FJ1030-15-40**  
(W148mm, H40mm, L70mm)


#### High

- A** Moveable Jaw ..... **5MJ1030-10-55**  
(W99mm, H55mm, L105mm)
- B** Fixed Jaw ..... **5FJ1030-10-55**  
(W99mm, H55mm, L70mm)

#### Oversized

- A** Moveable Jaw ..... **5MJ1030-15-55**  
(W148mm, H55mm, L105mm)
- B** Fixed Jaw ..... **5FJ1030-15-55**  
(W148mm, H55mm, L70mm)

## QwikChange Machinable Single Station Jaws

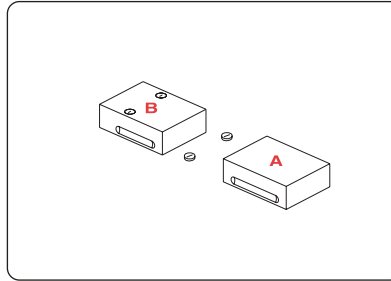

### Individual Single Station Jaws

#### Standard

- A** Moveable Jaw ..... **5MJ1030-10-40**  
(W99mm, H40mm, L105mm)
- B** Fixed Jaw ..... **5SJ1030-10-40**  
(W99mm, H40mm, L105mm)

#### Wide

- A** Moveable Jaw ..... **5MJ1030-15-40**  
(W148mm, H40mm, L105mm)
- B** Fixed Jaw ..... **5SJ1030-15-40**  
(W148mm, H40mm, L105mm)

#### High


- A** Moveable Jaw ..... **5MJ1030-10-55**  
(W99mm, H55mm, L105mm)
- B** Fixed Jaw ..... **5SJ1030-10-55**  
(W99mm, H55mm, L105mm)

#### Oversized


- A** Moveable Jaw ..... **5MJ1030-15-55**  
(W148mm, H55mm, L105mm)
- B** Fixed Jaw ..... **5SJ1030-15-55**  
(W148mm, H55mm, L105mm)

## Screws and Plugs

### Dual Station

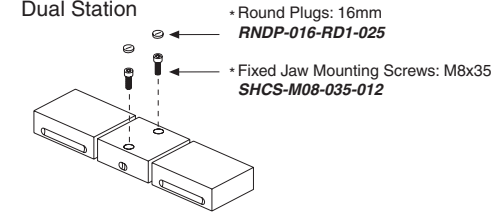


### Single Station

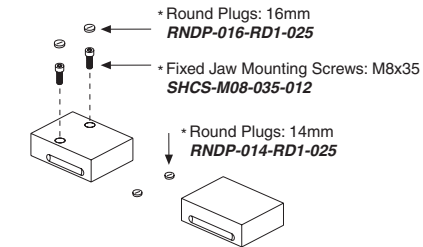

## Faceplate Round & Diamond Pin Set

(Included w/ Faceplate purchase)

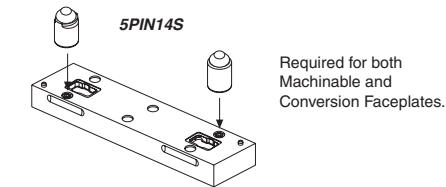


### Notes


Grey or \* item is included with a standard system

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

Dual Station

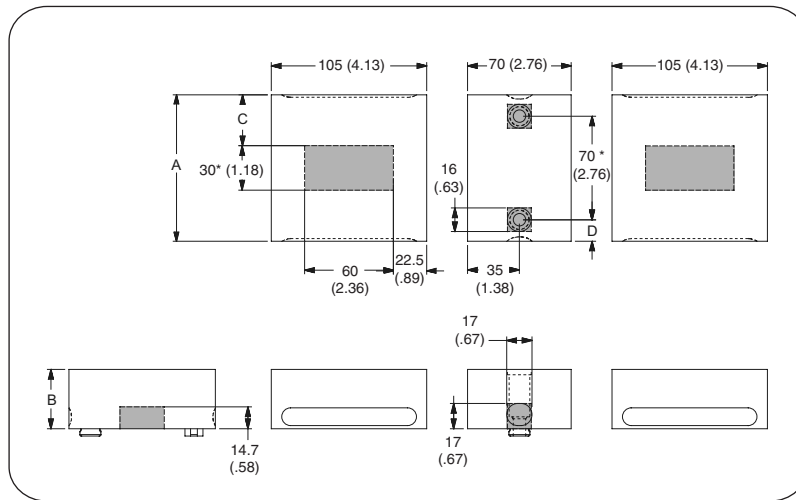

Single Station

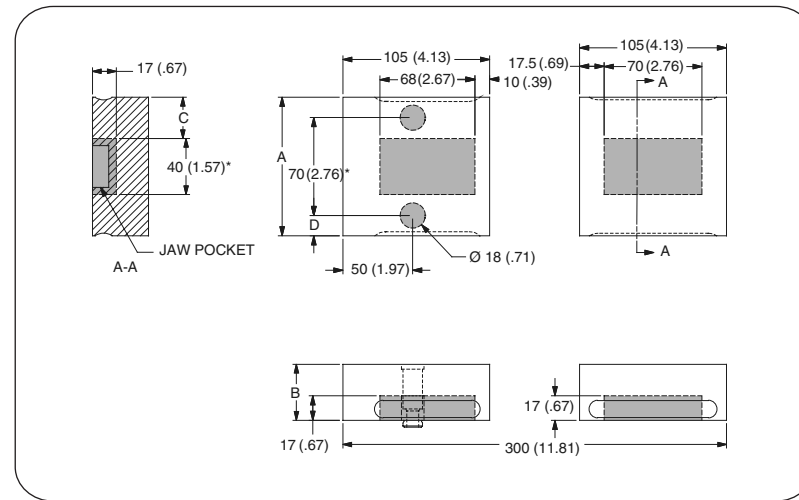

Item Number	Description	A	B	C	D
<b>5DS1030-10-40</b>	Standard	99 [3.90]	40 [1.57]	34.5 [1.36]	14.5 [.57]
<b>5DS1030-10-55</b>	High	99 [3.90]	55 [2.17]	34.5 [1.36]	14.5 [.57]
<b>5DS1030-15-40</b>	Wide	148 [5.83]	40 [1.57]	59 [2.32]	39 [1.54]
<b>5DS1030-15-55</b>	Oversized	148 [5.83]	55 [2.17]	59 [2.32]	39 [1.54]

Item Number	Description	A	B	C	D
<b>5SS1030-10-40</b>	Standard	99 [3.90]	40 [1.57]	29.5 [1.16]	14.5 [.57]
<b>5SS1030-10-55</b>	High	99 [3.90]	55 [2.17]	29.5 [1.16]	14.5 [.57]
<b>5SS1030-15-40</b>	Wide	148 [5.83]	40 [1.57]	54 [2.13]	39 [1.54]
<b>5SS1030-15-55</b>	Oversized	148 [5.83]	55 [2.17]	54 [2.13]	39 [1.54]


Notes

Grey area indicates no cut zone  
 All dimensions are MM [IN]  
 Dimensions centered on the "A" dimension.


**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)



**Dual Station**

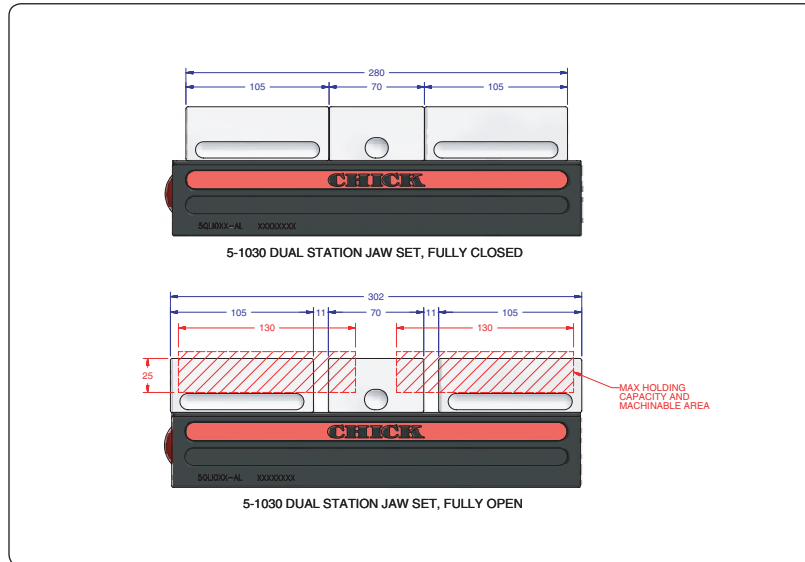

**Single Station**

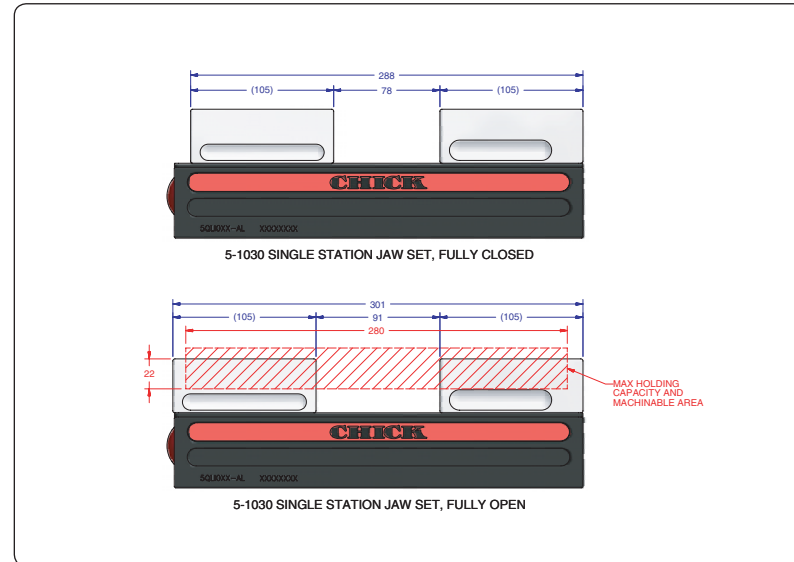


Item Number	Description	A	Jaw Width
<b>5DS1030-10-40</b>	Standard	26 [1.02]	99 [3.90]
<b>5DS1030-10-55</b>	High	41 [1.61]	99 [3.90]
<b>5DS1030-15-40</b>	Wide	26 [1.02]	148 [5.83]
<b>5DS1030-15-55</b>	Oversized	41 [1.61]	148 [5.83]

Item Number	Description	A	Jaw Width
<b>5SS1030-10-40</b>	Standard	26 [1.02]	99 [3.90]
<b>5SS1030-10-55</b>	High	41 [1.61]	99 [3.90]
<b>5SS1030-15-40</b>	Wide	26 [1.02]	148 [5.83]
<b>5SS1030-15-55</b>	Oversized	41 [1.61]	148 [5.83]

**Notes**


All dimensions are MM [IN]  
 Additional closure is available with an Extended Travel Coverplate.  
 Contact CHICK for details.

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

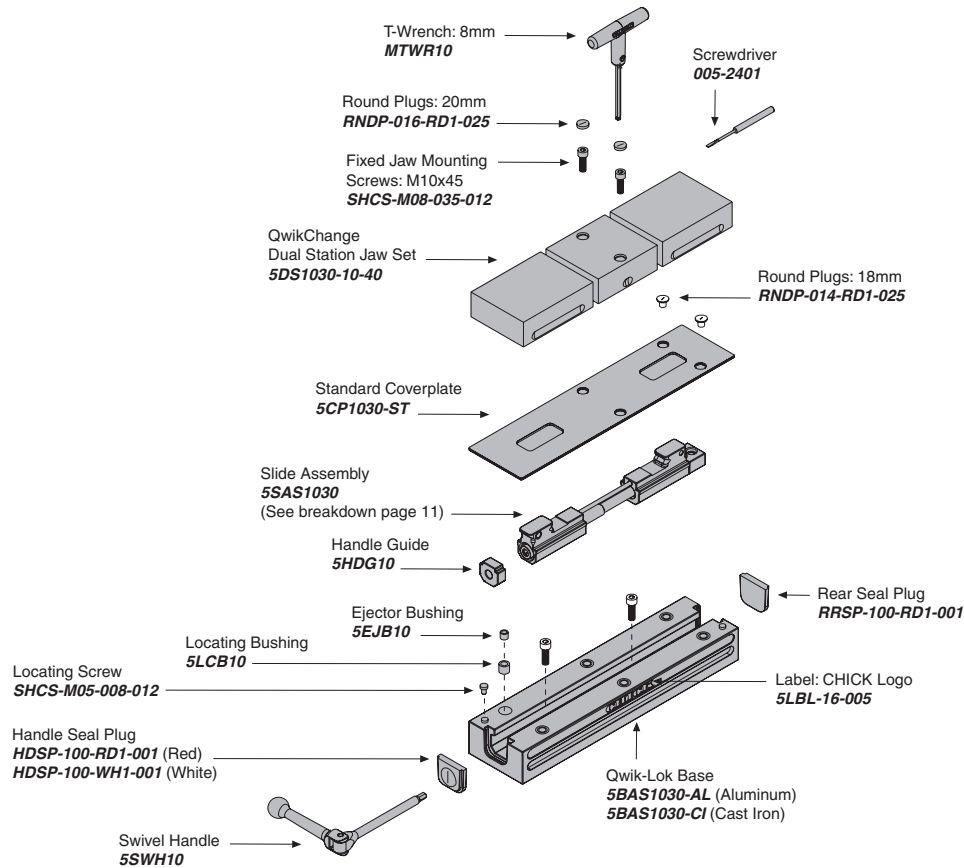


**MOUNTING**

**Foundation**

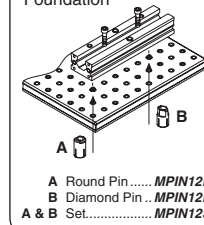


**T-Slotted Table**

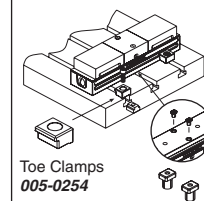

Bolt and T-Nut supplied by customer

**Bottom of Base**

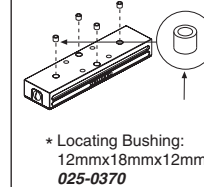


**Locating Keys**

Inch Size
MKE500 (1/2")
MKE562 (9/16")
MKE625 (5/8")
MKE688 (11/16")
MKE750 (3/4")
MKE812 (13/16")
Metric Size
MKE10 (10mm)
MKE12 (12mm)
MKE14X18 (14mm)
MKE16 (16mm)
MKE20 (20mm)

**Notes**

Grey items are included with a standard system  
 For QwikChange™ Jaw accessories, see pages 5-8

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
 www.ChickWorkholding.com

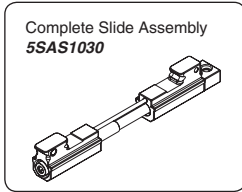

**Notes**


Grey items are included with a standard system

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)

**Pounds (lbs)**

Force	=	Torque	X	Slope
lbs	=	in-lb	x	8.0
lbs	=	ft-lbs	x	96

Torque (ft-lb)	Force (lbs)
0	0
10	962
20	1923
30	2885
40	3846
50	4808
52	5000

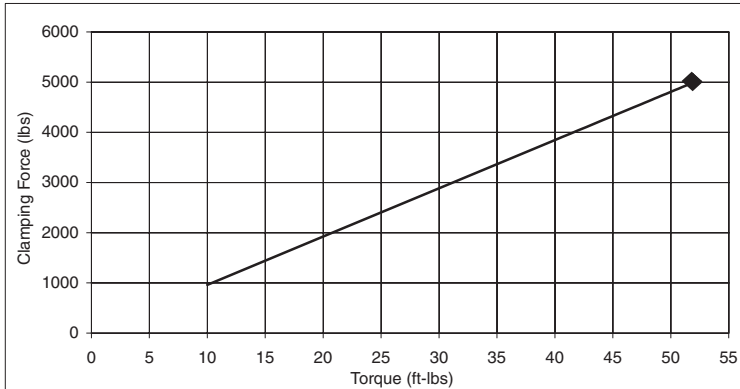


Note: **◆** Maximum Recommended Torque. Actual results may vary.

**Kilonewtons (kN)**

Force	=	Torque	X	Slope
N	=	N-m	x	315
kN	=	N-m	x	0.315

Torque (N-m)	Force (kN)
0	0.0
10	3.1
20	6.3
30	9.4
40	12.6
50	15.7
60	18.9
65	20.5
70	22.0

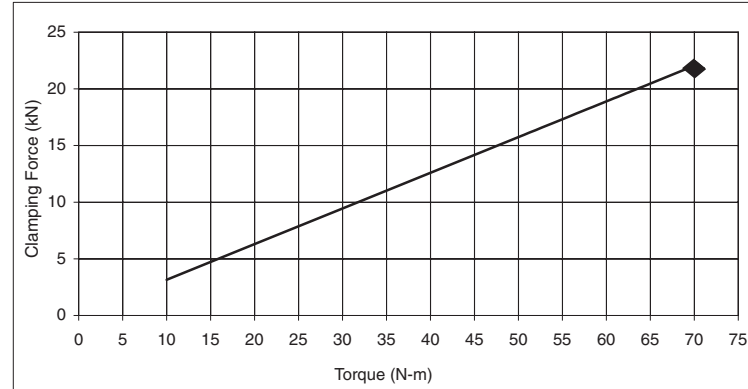

Note: **◆** Maximum Recommended Torque. Actual results may vary.

Notes

**CHICK WORKHOLDING SOLUTIONS, INC**  
 500 Keystone Drive • Warrendale, PA 15086 USA  
 Phone: (724) 772-1644 • Fax: (724) 772-1633  
 Toll Free: (800) 33-CHICK • (800) 332-4425  
[www.ChickWorkholding.com](http://www.ChickWorkholding.com)